











ELECTRICAL SYMBOLS LEGEND & NOTES	
	1X4 EXISTING LIGHT FIXTURE
	DUPLEX SWITCH
	21"X21" VENT AT CEILING
	EXPOSED DUCTING AT CEILING POSSIBLY FOR EXISTING HOOD
	EXISTING 2X2 ACOUSTICAL TILE
	EXISTING CEILING MOUNTED LIGHT FIXTURE
	2X4 EXISTING LIGHT FIXTURE
	2X2 EXISTING LIGHT FIXTURE
	EXISTING DUPLEX OUTLET LOCATED ON WALL SURFACE
	EXISTING FLOOR DRAIN
	EXISTING OUTLET/@ FLOOR
	EXISTING FIRE EXTINGUISHER (TO BE UPGRADED BY OTHERS DOE COMMERCIAL GRADE FIRE EXTINGUISHERS)
	EXISTING ELECTRICAL PANELS
	EXISTING FIRE SUPPRESSION SYSTEM

ELECTRICAL NOTES

- 1

CONTRACTOR TO REMOVE AND REPLACE ANY LIGHT BULBS OR BALLASTS THAT ARE IN OPERABLE OR NOT FUNCTIONING PROPERLY.
- 2

CONTRACTOR TO VERIFY THAT ALL EXISTING ELECTRICAL PANEL BOXES ARE OPERABLE AND CAP TO CODE ANY PANEL BOXES OR ELECTRICAL LINES THAT ARE NOT BEING USED FOR ANY PART OF THE KITCHEN OR ANY PLACE ELSE ON THE SCHOOL
- 3

CONTRACTOR TO REMOVE AND CAP ANY EXISTING FLOOR MOUNTED ELECTRICAL OUTLETS THAT ARE NOT BEING USED BY EXISTING OR NEW ELECTRICAL EQUIPMENT IN THE KITCHEN
- 4

REMOVE ELECTRICAL PANEL BOX NOTED ON PLAN AND RELOCATE TO WALL NOTED ON THE PLAN UPGRADE PANEL BOX (SEE NOTE 6) AS PER CODE AND EXISTING EQUIPMENT
- 5

ELECTRICAL PANEL TO REMAIN ON THIS WALL SURFACE CONTRACTOR SHALL VERIFY IF PANEL BOX IS OPERABLE
- 6


CONTRACTOR TO VERIFY ALL FLOOR MOUNTED DUPLEX OUTLET AND SWITCHES IF NOT REQUIRED FOR NEW KITCHEN EQUIPMENT CONTRACTOR SHALL REMOVE AND OR CAP AS NECESSARY.REPAIR AS REQUIRED IF NOT OPERABLE FOR NEW USAGE
- 7

CONTRACTOR REMOVE EXISTING LIGHT FIXTURE AND REPLACE WITH SIMLIAR SURFACE MOUNTED FIXTURE
- 8

CONTRACTOR VERIFY EXISTING EXHAUST HOOD AND EXHAUST HOOD SWITCH IS OPERABLE AND IN COMPLIANCE WITH NFPA CODES . IF NON OPERABLE CONTRACTOR SHALL REPAIR EXISTING EXHAUST HOOD AND SWITCH AND ENSURE IT IS OPERABLE TO ACCOMODATE EQUIPMENT AS PER MANUFACTURER'S SPECIFICATIONS.
- 9

EXISTING FIRE SUPRESSION SYSTEM TO BE REMOVED AND REPLACED AS SPECIFIED IN ACCORDANCE AND IN COMPLIANCE WITH NFPA CODES AND LOCAL BUILDING AND FIRE SAFETY CODES.
- 10

CONTRACTOR SHALL INSPECT ALL DUCT WORK IN THE VINICITY OF THE KITCHEN AND IDENTIFY IF IT IS IN FAVORABLE CONDITION FOR PROPER OPERATION AND NOTIFY ARCHITECT OF EXSITING CONDITION

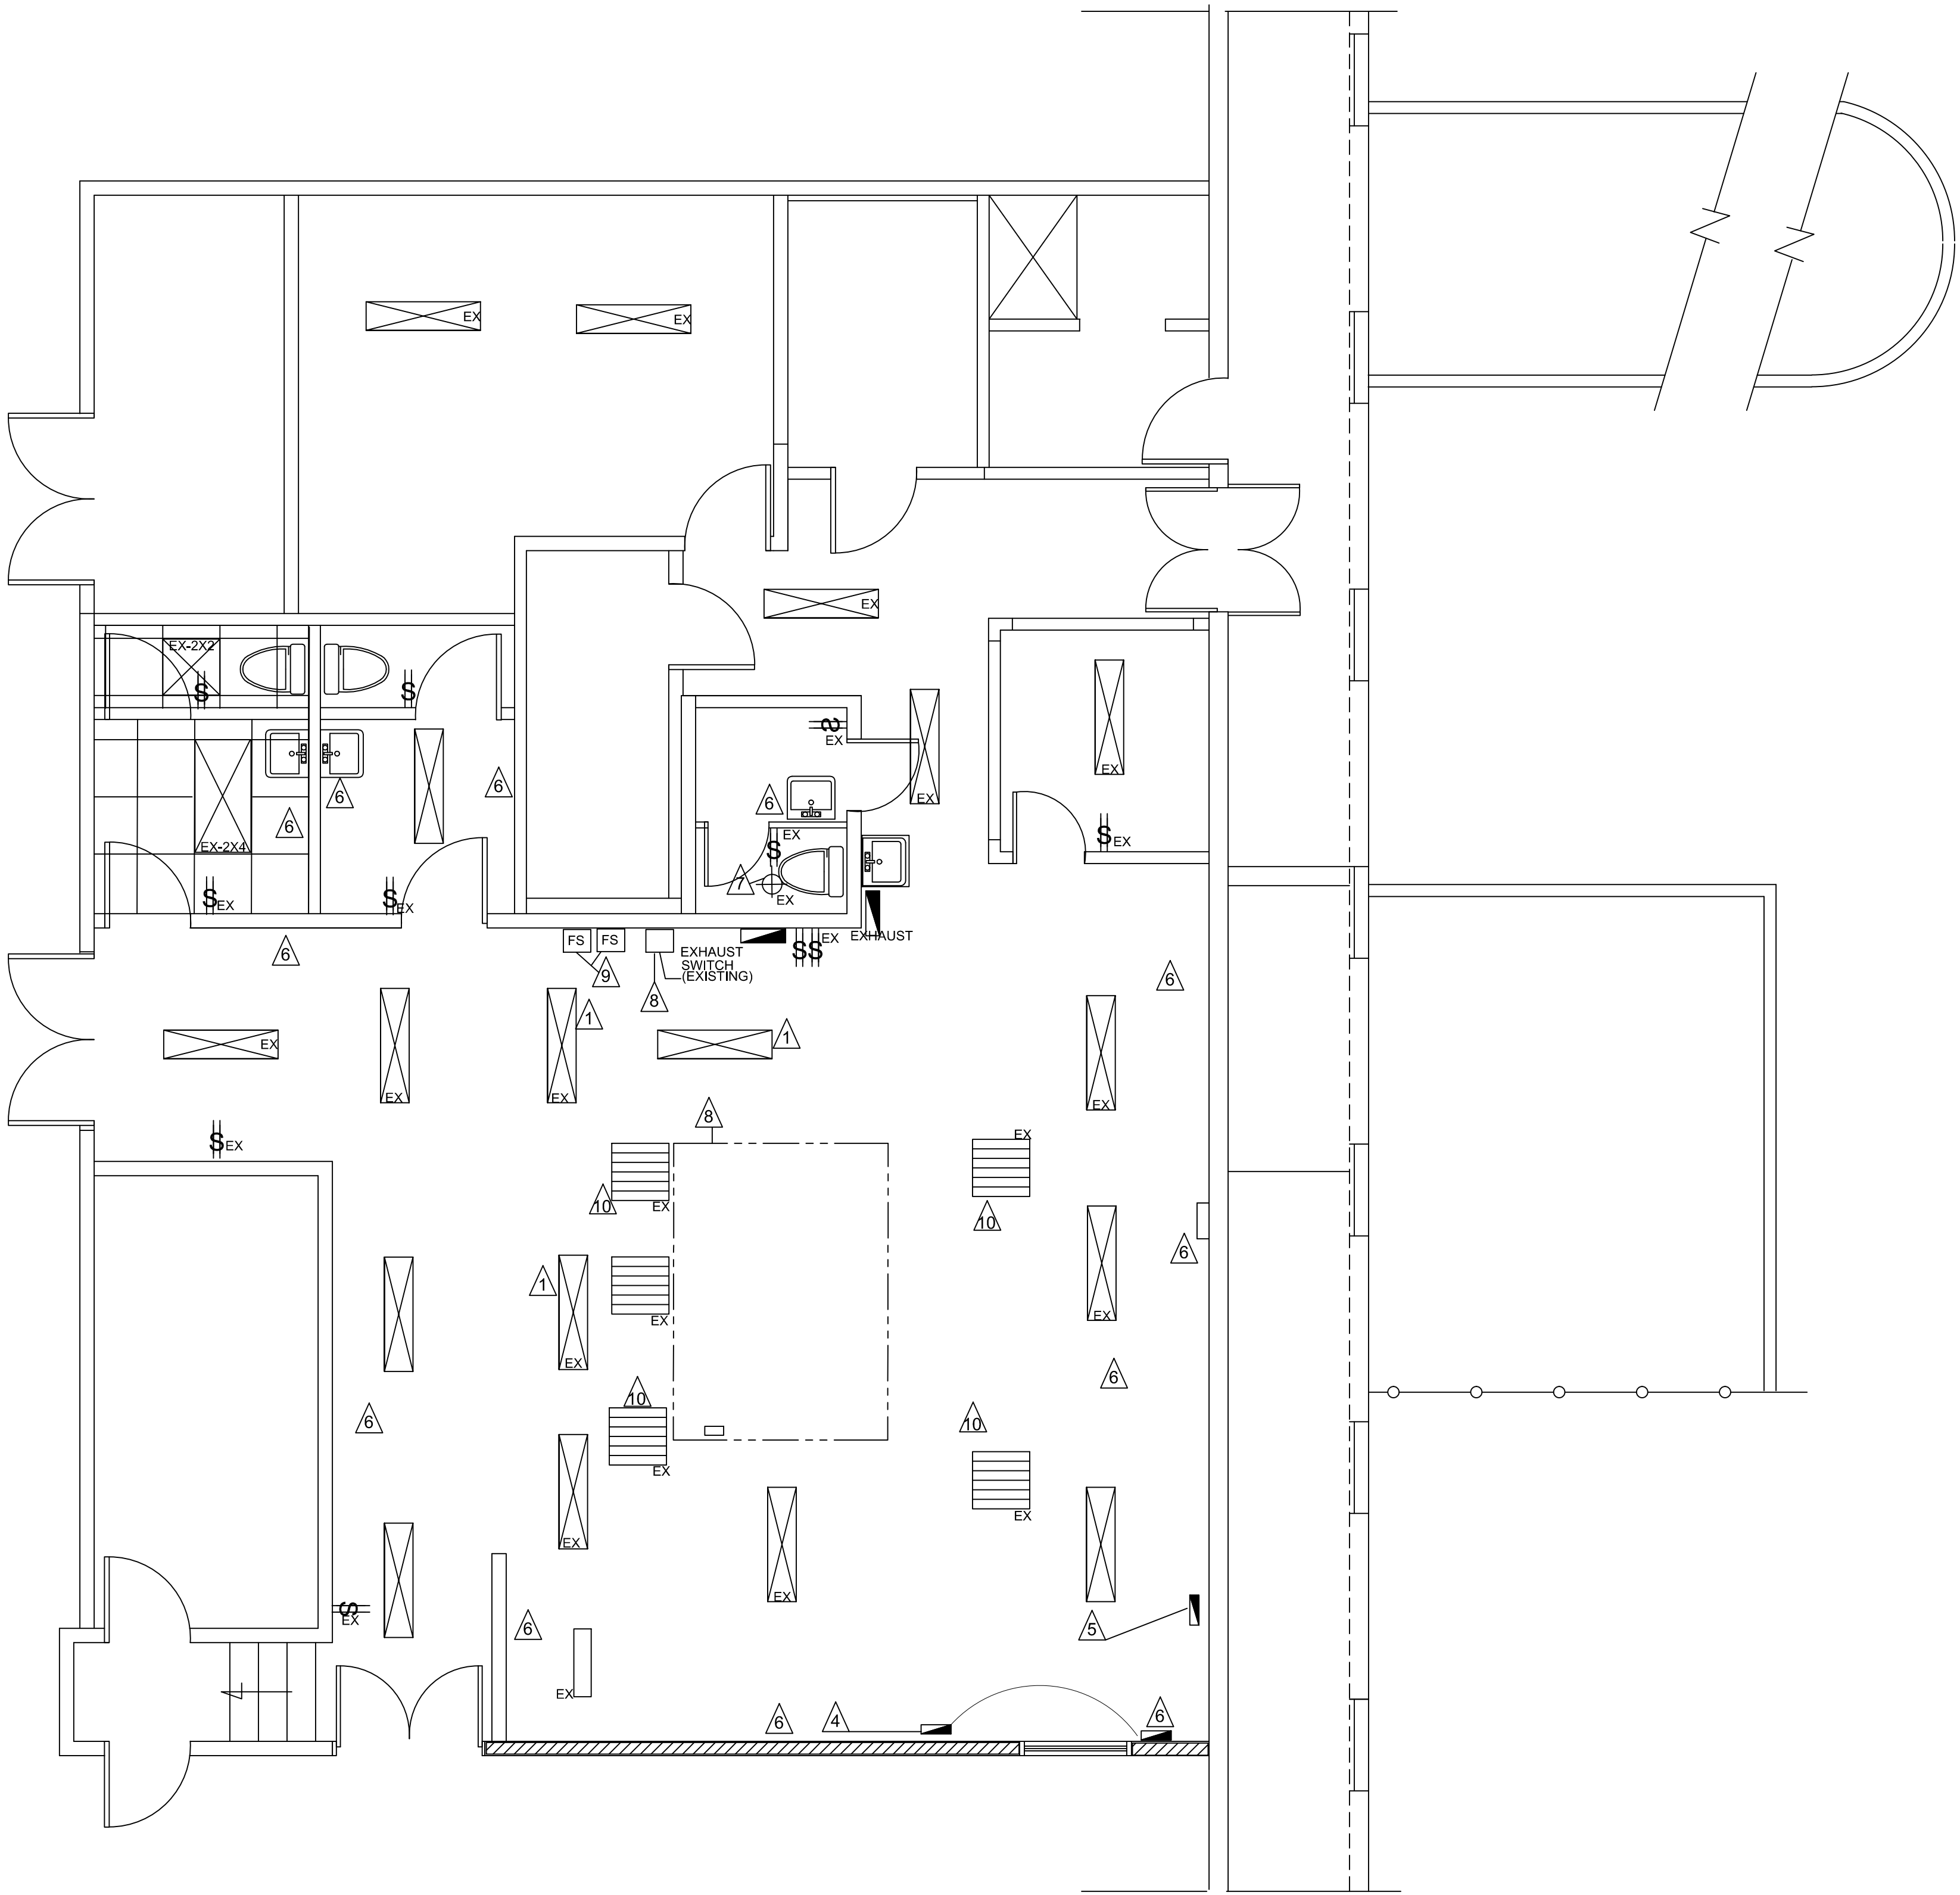


Caribbean
Professional
Consultants
112 BOURNFIELD
LINDBERG RAY, ST THOMAS
P.O.Box 305647
St Thomas U.S.V.I. 00803
Tel: 340-774-3357

REVISIONS		REMARKS
NO.	DATE	

EXISTING LIGHTING LAYOUT AND NOTES
E. BENJAMIN OLIVER ELEMENTARY SCHOOL
148-325 PLAMETTO ROAD
ST THOMAS U.S. VIRGIN ISLANDS

DRAWN BY:	LD
CHECKED BY:	E. BLAIZE
APPROVED BY:	E. BLAIZE
CONTRACT NO.:	CONTRACT.NO.
PROJECT NO.:	PROJ.NO.
DATE:	

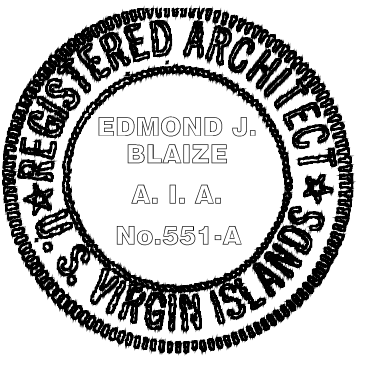

SHEET NO.:
EX-E1.1
SHEET NO. # OF # SHEETS